

## TIG WELDING SYSTEM


### Operating devices TIG welding system WIG 180 DC

Main switch: On/Off

Slot for carry strap

Connection jacks for positive and negative poles +/-

Air outlet

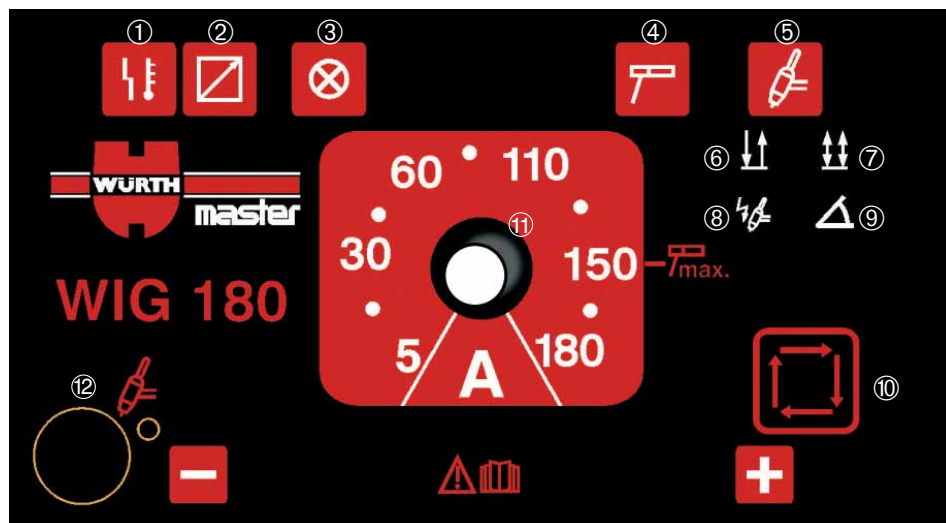

#### Controls:

- ① Fault indicator LED
- ② Foot-oper. remote ctrl. ind. LED
- ③ Power indicator LED
- ④ Electrode welding indicator LED
- ⑤ TIG welding indicator LED
- ⑥ 2-cycle welding indicator LED
- ⑦ 4-cycle welding indicator LED
- ⑧ High-frequency ignition (HF ignition) indicator LED
- ⑨ Slope function indicator LED  
Controls automatic current reduction upon completion of welding process
- ⑩ Main function button for setting the individual device functions
- ⑪ Rotary switch for setting the welding current level
- ⑫ Control line connection (TIG torch)