

SERIES 2000 STEEL PNEUMATIC FITTINGS



Series 2000 Quick-Action Coupling with Hose Connection for Würth PVC and Painting Hoses

Hose dia. Inside in mm	Outside in mm	Length in mm	Dia. in mm	Flow rate in l/min.	Art. No.	P. Qty.
6.0	11.0 - 12.0	67	23	2,100	0699 100 106	3
9.0	14.5 - 16.0	70	23	2,100	0699 100 108	3
13.0	19.0	68	23	2,100	0699 100 113	3




Series 2000 Plug-In Nipple with Hose Connection for Würth PVC and Painting Hoses

Hose dia. Inside in mm	Outside in mm	Length in mm	Flow rate in l/min.	Art. No.	P. Qty.
6.0	11.0/12.0	42	2,100	0699 100 406	3
9.0	14.5/16.0	45	2,100	0699 100 408	3
13.0	19.0	45	2,100	0699 100 413	3



Series 2000 Quick-Action Coupling with Comfort Connection for Würth PU Hoses

Hose dia. Inside in mm	Outside in mm	Length in mm	Dia. in mm	Flow rate in l/min.	Art. No.	P. Qty.
6.5	10.0	64	23	2,100	0699 100 765	3
8.0	12.0	68	23	2,100	0699 100 780	3
11.0	16.0	68	23	2,100	0699 100 711	3

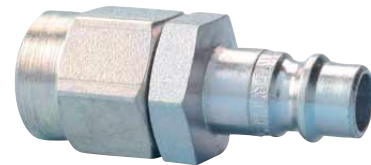

Series 2000 Plug-In Nipple with Comfort Connection for Würth PU Hoses

Hose dia. Inside in mm	Outside in mm	Length in mm	Flow rate in l/min.	Art. No.	P. Qty.
6.5	10.0	44	2,100	0699 100 865	3
8.0	12.0	47	2,100	0699 100 880	3
11.0	16.0	56	2,100	0699 100 811	3



Series 2000 Push-In Tip with Comfort Connection for Würth PU Hoses, Male Thread

Connections Male thread R	Hose in mm	Length in mm	Wrench size in mm	Flow rate in l/min.	Art. No.	P. Qty.
1/4"	8.0 x 12.0	41	19	2,100	0699 100 980	1
1/4"	9.5 x 13.5	43	21	2,100	0699 100 995	1
1/2"	11.0 x 16.0	51	24	3,500	0699 356 007	3



Series 2000 Push-In Tip, Rotating, with Comfort Connection for Würth PU Hoses, Male Thread

Connections Male thread R	Hose in mm	Length in mm	Flow rate in l/min.	Art. No.	P. Qty.
1/4"	6.5 x 10.0	44	1,500	0699 100 914	3
3/8"	8.0 x 12.0	46	2,100	0699 100 938	3
1/2"	11.0 x 16.0	51	3,500	0699 100 912	3

Hose connection for Würth PVC and painting hoses



Slide the 1-ear clamp over the hose.




Then slide hose up over grommet as far as possible while twisting back and forth slightly.



Tighten 1-ear clamp.

Comfort connection for Würth PU hoses



Screw off locking bush and slide over hose.



Then slide hose up over grommet as far as possible while twisting back and forth slightly.



Then screw on the locking bush as far as possible.